

Shipping industry guidance  
on **The**  
**rigging of**  
**ladders**  
for pilot transfer

Ensuring compliance with  
SOLAS

International Maritime Pilots' Association  
International Chamber of Shipping  
International Shipping Federation



Also supported by:



BIMCO



INTERCARGO



INTERTANKO



Oil Companies International  
Marine Forum



Society of International  
Gas Tanker and  
Terminal Operators





Vessel with defects in the boarding arrangements

# Shipping industry guidance on **The rigging of ladders for pilot transfer**

## Ensuring compliance with SOLAS

The following guidance has been produced by the International Maritime Pilots' Association (IMPA) in collaboration with the International Chamber of Shipping (ICS) and the International Shipping Federation (ISF).

### General

Pilots come aboard ship to assist the crew during the most critical and potentially hazardous phases of a voyage. Qualified pilots possess exceptional local knowledge and have the necessary ship-handling skills to assist the safe arrival and departure of vessels.

Normally, pilots board and disembark using a traditional rope ladder from and to a pilot boat. However, this can be a very dangerous procedure if those involved do not adhere to International Maritime Organization (IMO) standards or fail to practise acceptable seamanship skills.

Most regrettably, in recent years, several pilots have died as a result of accidents while boarding/disembarking from ships, and many more have been seriously injured.

Furthermore, deficiencies with regard to boarding arrangements and unsafe rigging of pilot ladders continue to be detected during port state control inspections, resulting in delays and financial penalties for the ship operator.

Nevertheless, pilot ladders remain the most safe and efficient way to board ships at sea and there is usually no alternative, except on occasions when a helicopter is used.

The following guidance is intended to remind seafarers and shipping companies of the vital importance of adhering to the rules and established procedures concerning the provision of safe boarding arrangements for pilots.

### Ensuring safe rigging for pilots

The IMO Convention for Safety of Life at Sea (SOLAS Chapter V, Regulation 23) sets out the principal requirements for the rigging of pilot ladders.

These provisions are set out in the diagram contained in this brochure. This diagram can be downloaded at [www.impahq.org](http://www.impahq.org) (on the home page, click on 'Downloads'). It is also reproduced in the ICS Bridge Procedures Guide.

There is a further detailed technical specification for pilot ladders in IMO Resolution A.889(21). Shipping companies have a legal obligation to provide a conforming ladder and ship-borne fittings. If seafarers are uncertain about any of the requirements, they should always ask their supervising officer for advice.

The two major causes of accidents are defects in the ladder treads or sideropes (see diagram) or a lack of proper attachment of the ladder to the vessel.

Seafarers should always check the condition of the ladder before it is rigged and also ensure it is secure to the ship. Whilst this is done, seafarers should always take care of their own safety, wearing a life jacket (and a life-line if appropriate).

### Management issues

Shipping companies should ensure that:

- Ladders are SOLAS compliant
- The inspection regime and records are adequate
- Replacement ladders are quickly and readily available, preferably by carriage of at least one spare ladder
- Seafarers involved receive the necessary training and have a full understanding of the requirements.

IMPA is able to provide an advice document for new construction designs.

### On board issues

The Master and officers should:

- Closely supervise the rigging of pilot ladders
- Closely observe the shipping/landing of pilots from ladders ensuring that SOLAS requirements are met
- Maintain a lee until the pilot vessel is well clear.

### Summary







Pilots have the right to decline to board vessels offering defective ladders, which can result in serious delay. Pilots are also entitled to report defects in boarding ladders to port state control authorities, which could lead to a full PSC inspection with the risk of delay and financial penalties.

A pilot who has climbed a sound ladder, well rigged, and attended by an officer and a deck party will be in the right frame of mind to give his best attention to the safety of the vessel.

# REQUIRED BOARDING ARRANGEMENTS FOR PILOT

In accordance with I.M.O. requirements and I.M.P.A. recommendations  
**INTERNATIONAL MARITIME PILOTS' ASSOCIATION**

H.Q.S "Wellington", Temple Stairs, Victoria Embankment, London WC2R 2PN Tel: +44 20 7240 3973 Fax: +44 20 7240 3518

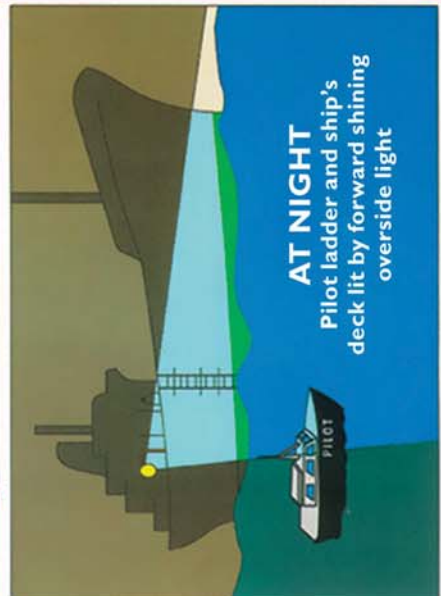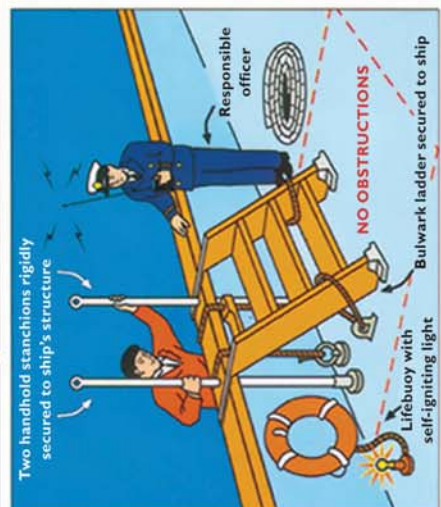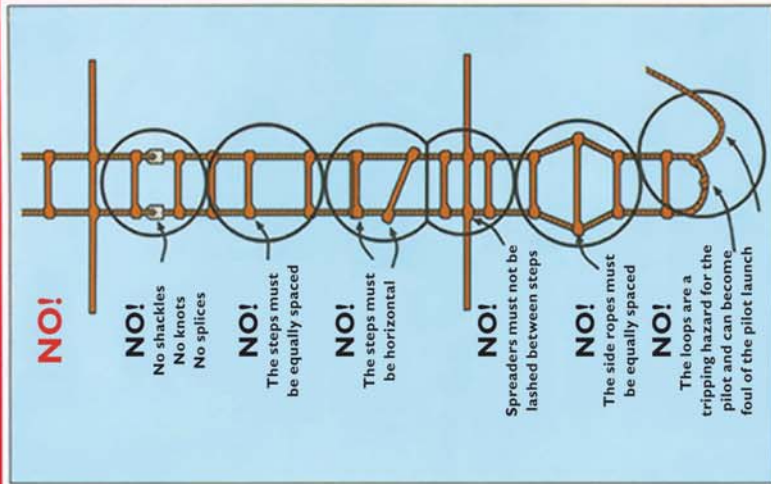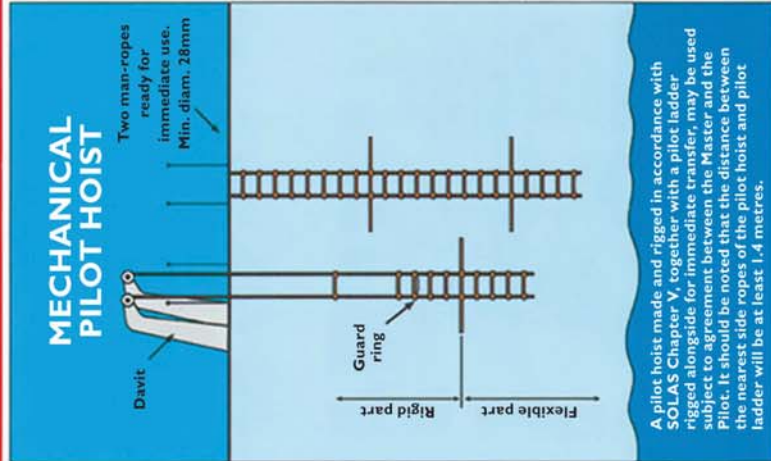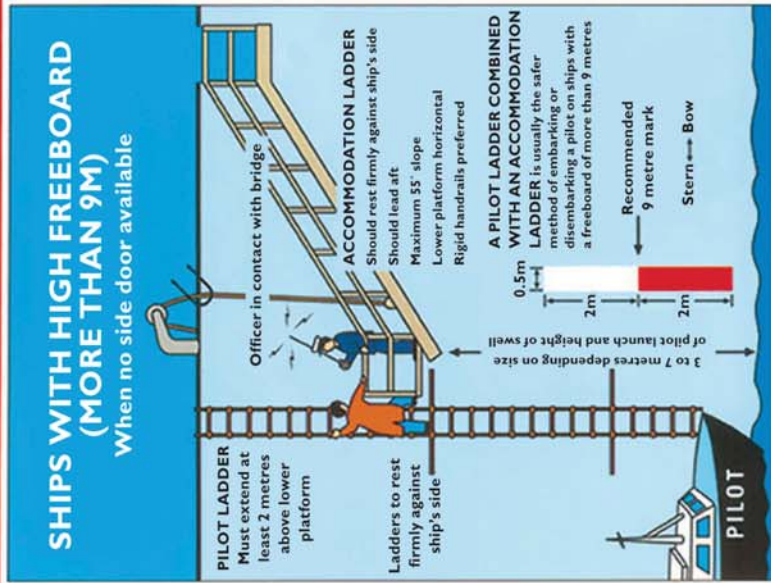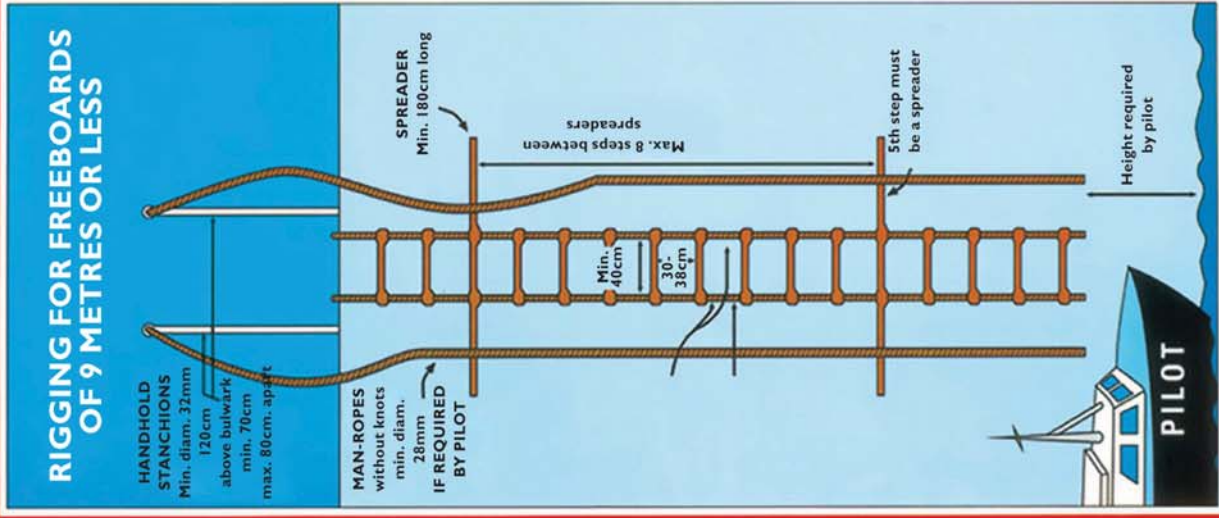

Approved by I.M.O.

## Shipping industry guidance on the rigging of ladders for pilot transfer

Published by:

Maritime International Secretariat  
Services Limited  
12 Carthusian Street  
London EC1M 6EZ

Tel +44 20 7417 8844

Fax +44 20 7417 8877

[publications@marisec.org](mailto:publications@marisec.org)

[www.marisec.org](http://www.marisec.org)

First edition 2008

An electronic version of this leaflet is  
available at:

**[www.marisec.org/pilotladders](http://www.marisec.org/pilotladders)**

These guidelines have been developed using the best information available, but they are intended for guidance only, to be followed at the users' own risk. No responsibility is accepted by any firm, corporation or organisation who or which has been in any way concerned with the furnishing of data, the compilation, publication or authorised translation, supply or sale of this guidance, for the accuracy of any information or advice given herein, or any omission herefrom or consequences whatsoever resulting directly or indirectly from use of these guidelines or from compliance with or adoption of guidance contained therein.

International Maritime Pilots' Association  
International Chamber of Shipping  
International Shipping Federation



Also supported by:

